



Bulletin

TECHNICAL INFORMATION /COMMERCIAL, GOVERNMENT & INDUSTRIAL SOLUTIONS SECTOR

SRN - 1494
APC - 136
August 2005

Informational Only

Distribution: Service: MOL: Software/Paging

From: Paging Product Group

Subject: **Minitor V “Push To Listen” feature does not work correctly**

Symptoms:

When a Minitor V pager is programmed with Push to Listen (PTL) feature enabled and the reset function is set to “Revert” or “Revert-N”, the unit’s audio will not remain muted, as if the PTL feature was not selected.

Potential Problem Units:

All Minitor V pager models with serial numbers before 136WFQ0000.

Cause:

Firmware defect in version 2.7 or below.

Corrective Action:

Pager firmware must be upgraded to version 2.8. A firmware upgrade tool, “Minitor V Firmware Flasher”, is now available for download from Motorola Online (MOL) in the Resource Center/Software/Paging/Firmware/Flashing” area.

This bulletin is informational only. No labor warranty or other charges are implied or intended.

If applicable, enter this information or note this bulletin number and subject material in the appropriate equipment instruction manuals and make necessary schematic diagram changes. Enter this bulletin in the correct MASTER and CLASSIFIED INDICES for future reference. **Labor and/or parts warranty reference is limited to products sold and in use in the United States. For products sold and in use Internationally, this bulletin is for informational purposes only. Radios that are Agency Approved must follow designated agency guidelines.**
SRN-ISO